



Inspection Report

Matthew Missimer

Property Address:
552 Colonial Ave
Souderton Pa 18964



A1 House Prep LLC and Inspections

Robert L. Johnson ASHI #261998
340 Freed Road
Harleysville, Pa 19438
215-853-8226

Table of Contents

Cover Page.....	1
Table of Contents.....	2
Intro Page	4
1 Roofing / Chimneys / Roof Structure and Attic	5
2 Exterior.....	12
3 Garage	20
4 Kitchen Components and Appliances.....	23
5(A) Breakfast Area	27
5(B) Mud Room.....	29
5(C) Foyer.....	31
5(D) Living Room.....	33
5(E) Family Room.....	35
5(F) Owners Suite.....	38
5(G) Bedroom #2	40
5(H) Bedroom #3	43
5(I) Bedroom #4	45
6(A) 1/2 Bath.....	48
6(B) Hall Bath.....	50
6(C) Owners Suite Bath	53
7 Laundry Area	56
8 Electrical System	58
9 Plumbing System.....	62
10 Heating / Central Air Conditioning.....	65
11 Structural Components	69
12 IMPORTANT (Note to Buyer)	74
13 Report Conclusion	75
14 ASHI Inspection Regulations	76
15 Lead Based Paint Law	77

[16 Government Mold Information78](#)

[17 Government Radon Information.....79](#)

[General Summary.....80](#)

[Electrical Summary..... 102](#)

[Plumbing Summary..... 107](#)

[Heating Cooling / Summary..... 110](#)

[Back Page..... 112](#)

Date: 04/14/20	Time: 11:00 AM	Report ID: 6824 Matthew Missimer
Property: 552 Colonial Ave Souderton Pa 18964	Customer: Matthew Missimer	Real Estate Professional: Lon Clemmer Sanford Alderfer Real Estate

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified person or contractor. **All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.**

Inspected (IN) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI)= I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified person or contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

Style of Home:

Colonial

Client Is Present:

No

Radon Test:

Yes

Termite Test:

Yes

Mold Test:

No

Water Test:

No

Weather:

Cloudy

Temperature:

Below 60

Rain in last 3 days:

Yes


Age of Home:

43 years old

1. Roofing / Chimneys / Roof Structure and Attic

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.



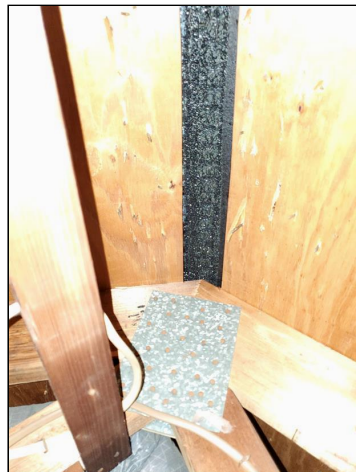



Styles & Materials

Viewed roof covering from:

Walked roof

Roof Covering:

Architectural

Chimney (exterior):

BRICK

Sky Light(s):

None

Roof Ventilation:

- Ridge vents
- Soffit Vents
- Gable vents
- Power Ventilator

Method used to observe attic:

Walked

Roof Structure:

- Engineered wood trusses
- Plywood
- Sheathing

Ceiling Structure:

2X4

Attic info:

Pull Down stairs

Attic Insulation:

- Blown
- Cellulose
- R-19 or better

Fire Escape:

No

Items

1.0 *** ROOF VIDEO *******

Comments: Inspected



ROOF VIDEO

Suggest to view roof video for more information.



1.0 Item 1(Video) *** ROOF VIDEO ***

1.1 ROOF COVERINGS

Comments: Repair or Replace



(1)

- Lower roof has signs of wear and tear and patched nail holes. Projected life span on lower roof; 5-7 years remaining with proper maintenance.
- Upper back roof appears newer and is in very good condition.


Recommend to view roof video for more information. FYI




1.1 Item 1(Picture)



1.1 Item 2(Picture)

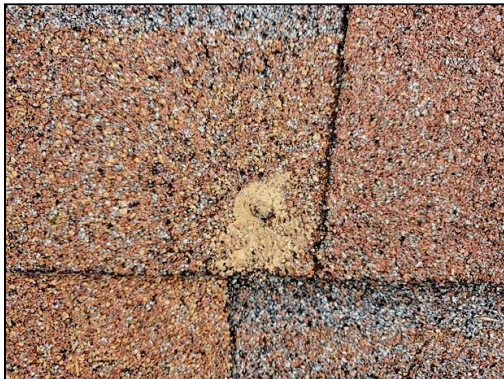

1.1 Item 3(Picture)

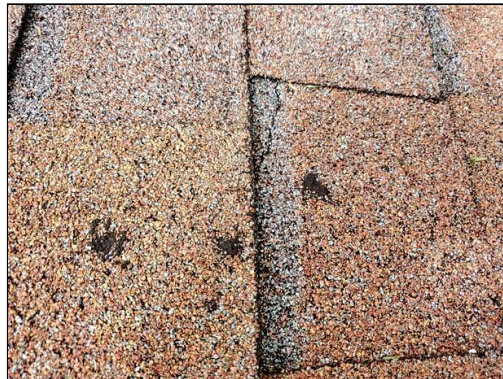

1.1 Item 4(Picture)



(2) The tree limbs that are in contact with roof or hanging near roof should be trimmed.



1.1 Item 5(Picture)

📍 (3) Shed roof is at the end of its' projected lifespan. Recommend to replace shed roof as needed by a qualified professional.



1.1 Item 6(Picture)



1.1 Item 7(Picture)

1.2 FLASHINGS

Comments: Inspected

1.3 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

Comments: Repair or Replace

📍 Cracked flue pipe. Recommend to repair or replace as needed by a qualified professional.



1.3 Item 1(Picture)



1.3 Item 2(Picture)


1.4 ROOF DRAINAGE SYSTEMS (gutters and downspouts)

Comments: Repair or Replace

📍 (1) Downspouts are not moving water effectively away from the foundation. Suggest to extend downspouts as discussed for better drainage away from the foundation. Saturating foundation walls for extended periods of time can cause potential unseen structural damage from water and insects. Could not determine how long water was flowing towards the foundation.



1.4 Item 1(Picture)

 (2) Gutters appear to be working properly. Could not verify condition of the downspouts and drains. Suggest to verify condition of all downspout drains as needed. Many basement leaks occur from clogged downspout drains.



1.4 Item 2(Picture)



1.4 Item 3(Picture)

1.5 *** ATTIC VIDEO *******

Comments: Inspected

ATTIC VIDEO

Suggest to view attic video for more information.




1.5 Item 1(Video) *** ATTIC VIDEO ***

1.6 ATTIC VENTILATION

Comments: Inspected

1.7 ROOF STRUCTURE AND ATTIC (Report leak signs or condensation)

Comments: Inspected

 No signs of present water penetration or condensation in the attic area on the day of the inspection.

1.8 VENTILATION FANS AND THERMOSTATIC CONTROLS (ATTIC)

Comments: Inspected

1.9 INSULATION IN ATTIC


Comments: Inspected


[Insulation Calculator](#)**1.10 VISIBLE ELECTRIC WIRING IN ATTIC**

Comments: Inspected

1.11 STEPS, STAIRWAYS AND RAILINGS

Comments: Repair or Replace

 Bent bracket at the pull down stairs. Recommend to repair as needed by a qualified person.

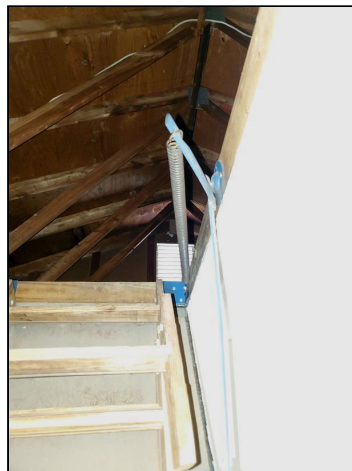

1.11 Item 1(Picture)



The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

2. Exterior

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. If buried tanks are present, highly recommend to have buried fuel tanks tested for condition before settlement by a professional tank testing company. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.



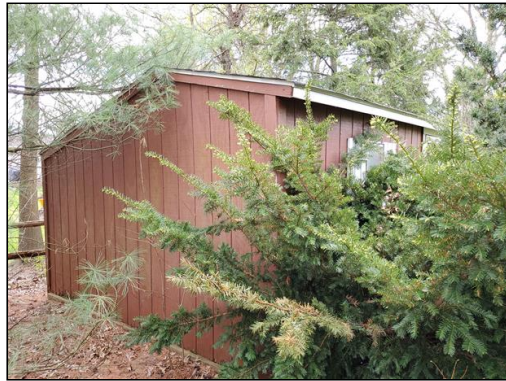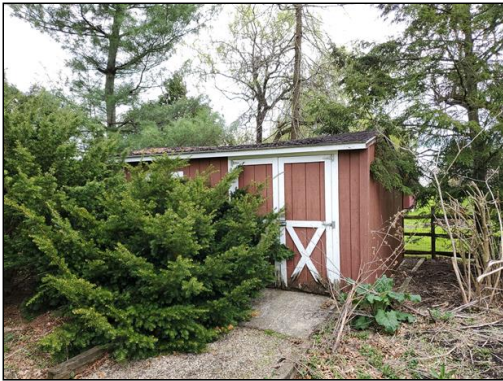

Styles & Materials

Siding Material:

- Brick
- Vinyl

Exterior Entry Doors:

- Insulated glass
- Metal
- Slider

Appurtenance:

- Patio

Driveway:

- Asphalt

Items

2.0 WALL CLADDING FLASHING AND TRIM

Comments: Repair or Replace

🏠 (1) Loose siding at the right and left side of the house. Recommend to secure siding as needed by a qualified professional.



2.0 Item 1(Picture)



2.0 Item 2(Picture)



2.0 Item 3(Picture)

🏠 (2) Deteriorated wood siding at the bottom of shed and interior walls. Recommend to repair or replace deteriorated wood as needed by a qualified person or professional.



2.0 Item 4(Picture)



2.0 Item 5(Picture)



2.0 Item 6(Picture)

📌 (3) The hole in siding needs closing off with sealant or liquid foam at the exterior where compressor lines enter the home in the attic. Potential for insect penetration.



2.0 Item 7(Picture)

2.1 WINDOWS

Comments: Inspected

📌 Missing a window well covers. Suggest to install clear plastic well covers over window wells to prevent potential well saturation which could overflow window sill and spill into the basement. **This is considered optional.**



2.1 Item 1(Picture)



2.1 Item 2(Picture)

2.2 DOORS (Exterior)

Comments: Inspected

2.3 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (With respect to their effect on the condition of the building)

Comments: Repair or Replace

📍 (1) Rotated and uneven concrete walkway. Recommend to repair as needed by a qualified person or professional. Potential tripping hazard exists.



2.3 Item 1(Picture)



2.3 Item 2(Picture)



2.3 Item 3(Picture)



2.3 Item 4(Picture)




2.3 Item 5(Picture)

📍 (2) Settled and separated patio wall at the rear of the house. Recommend to reset settled block as needed by a qualified person or professional.




2.3 Item 6(Picture)

📍 (3) Separated and rotated pavers at the rear of the house. Recommend to reset pavers as needed by a qualified person or professional.

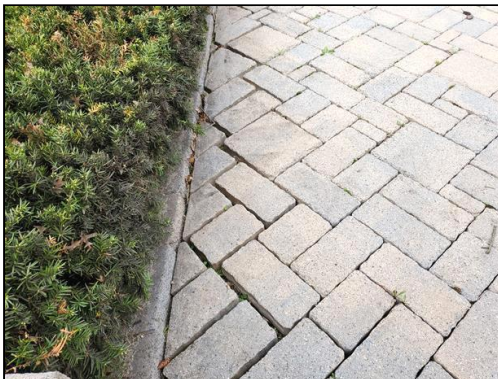

2.3 Item 7(Picture)

📍 (4) Gap between pavers and foundation at the rear of the house. Recommend to fill gap as needed to prevent potential water penetration.

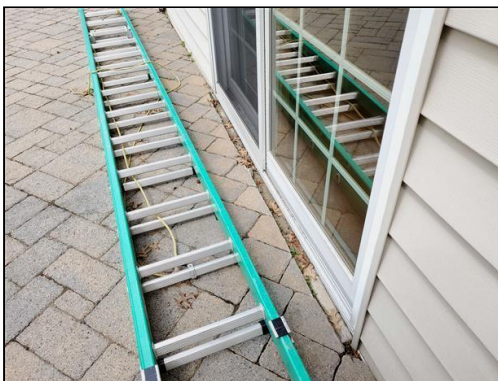

2.3 Item 8(Picture)

📍 (5) Shrubbbery and vegetation is growing too close to the siding for proper ventilation. Recommend to trim shrubbbery a minimum of of 12 to 16 inches away from the siding to restore proper ventilation. This would be considered normal maintenance.



2.3 Item 9(Picture)



2.3 Item 10(Picture)




2.3 Item 11(Picture)



2.3 Item 12(Picture)



2.3 Item 13(Picture)

 (6) Typical driveway settlement cracks. Recommend to repair or fill all cracks as needed by a qualified person. Also suggest to recoat driveway every 4 to 5 years. This would be considered normal maintenance.



2.3 Item 14(Picture)

2.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/ COVER AND APPLICABLE RAILINGS

Comments: Inspected

2.5 EAVES, SOFFITS AND FASCIAS


Comments: Inspected

2.6 PLUMBING WATER FAUCETS (hose bibs)

Comments: Inspected

2.7 RECEPTACLES & LIGHT FIXTURES

Comments: Repair or Replace

 2 outside receptacles are non GFI receptacles. Suggest to convert to GFIs for added protection against a potentially lethal electrical shock. Replace as needed by a qualified person or electrician.



2.7 Item 1(Picture)



2.7 Item 2(Picture)

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

Deck Maintenance

Due to the natural characteristics of wood and metal fastener deterioration, suggest to inspect decks on an annual basis and repair as needed. Decks are prone to deterioration from the natural elements.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

3. Garage

All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.



Styles & Materials

Garage Door Type: Two automatic	Garage Door Material: Metal Insulated	Auto-opener Manufacturer: LIFT-MASTER
Window Types: Double Pane	GFI Receptacles: No	Exterior Garage Door: No

Items

3.0 WINDOWS (REPRESENTATIVE NUMBER)

Comments: Inspected

3.1 OCCUPANT DOOR FROM GARAGE TO INSIDE HOME

Comments: Inspected

3.2 GARAGE DOOR (S) TO EXTERIOR

Comments: Not Present

3.3 OVERHEAD GARAGE DOOR

Comments: Inspected

3.4 GARAGE DOOR OPERATORS (Report whether or not doors will reverse when met with resistance)

Comments: Repair or Replace

🏠 Both garage doors needed excessive pressure for the auto reverse function to work properly. Recommend to adjust doors as needed by a qualified person for auto reverse to work correctly. Potential safety hazard exists.



3.4 Item 1(Picture)



3.4 Item 2(Picture)

3.5 GARAGE WALLS (INCLUDING FIREWALL SEPARATION)

Comments: Repair or Replace

🏠 Rotted and deteriorated sill plate from excessive water penetration on the exterior. Recommend to properly grade the exterior and repair as needed to prevent water and insect damage.



3.5 Item 1(Picture)

3.6 GARAGE FLOOR

Comments: Inspected

🏠 Typical hairline cracks located in the garage floor. Recommend to seal all cracks as discussed using a hydraulic cement as a way of monitoring floor for potential further movement. Repair as needed by a qualified person. This would be considered normal maintenance.



3.6 Item 1(Picture)

3.7 STEPS & RAILINGS


Comments: Not Present

3.8 CEILING

Comments: Inspected

3.9 OUTLETS SWITCHES AND FIXTURES

Comments: Repair or Replace

 Recommend to replace 3 conventional receptacles in the garage with GFI receptacles. This would be considered an added safety precaution against a potential severe electrical shock. Replace as needed by a qualified person.



3.9 Item 1(Picture)

Automatic Garage Door Safety Features

In 1993, a law was passed regarding garage door safety. It requires that any automatic door have one of the following features: a button that needs to be continually pressed for the door to close, an electric eye sensor, or a door edge sensor. A safe and well functioning garage door will also reverse when it comes into contact with an object in its path or whenever a sensor registers something in the path of the door. Modern garage doors should all contain some or all of these features. If your current door was installed prior to 1982, it may pose a risk to small children, pets, or property.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

4. Kitchen Components and Appliances

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.



Styles & Materials

Floor Covering(s):

Vinyl

Interior Doors:

None

Countertop:

Granite

Exhaust/Range hood:

THERMADOR

Range/Oven:

ELECTRIC

GENERAL ELECTRIC

KITCHEN AIDE

Wall Material:

Drywall

Window Types:

Thermal/Insulated

Disposer Brand:

IN SINK ERATOR

Wall Exhaust Fan:

No

Refrigerator:

KITCHENAIDE

Ceiling Materials:

Drywall

Cabinetry:

Wood

Dishwasher Brand:

KITCHEN AIDE

Built in Microwave:

KITCHEN AIDE


Trash Compactors:

NONE

Items

4.0 FLOORS

Comments: Repair or Replace

 Excessive gap in the kitchen floor. Recommend to repair as needed by a qualified person.



4.0 Item 1(Picture)

4.1 WALLS

Comments: Inspected

4.2 WALL EXHAUST FAN

Comments: Not Present

4.3 DOORS

Comments: Inspected

4.4 CEILING

Comments: Inspected

4.5 WINDOWS (REPRESENTATIVE NUMBER)


Comments: Inspected

4.6 COUNTERS AND A REPRESENTATIVE NUMBER OF CABINETS

Comments: Inspected

4.7 OUTLETS SWITCHES AND FIXTURES

Comments: Repair or Replace

 (1) Recommend to replace conventional outlets within 6 feet of kitchen sink with GFI receptacles. This would be considered an added safety precaution against a potential severe electrical shock.



4.7 Item 1(Picture)



4.7 Item 2(Picture)

🏠 (2) One nonfunctional recessed light fixture in the kitchen. Recommend to replace the bulb and test for function.



4.7 Item 3(Picture)

4.8 PLUMBING WATER SUPPLY FAUCETS AND FIXTURES

Comments: Inspected

4.9 FOOD WASTE DISPOSER

Comments: Repair or Replace

🔧 The food disposer wiring is missing a romex connector (anti-strain device). I recommend repair as needed.



4.9 Item 1(Picture)

4.10 PLUMBING DRAIN AND VENT SYSTEMS

Comments: Inspected

4.11 DISHWASHER

Comments: Inspected

4.12 MICROWAVE COOKING EQUIPMENT

Comments: Inspected

4.13 RANGES/OVENS/COOKTOPS

Comments: Inspected

🏠 Could not test the cook top. Did not have the correct pan to test. FYI

4.14 RANGE HOOD

Comments: Inspected

4.15 REFRIGERATOR

Comments: Inspected

4.16 TRASH COMPACTOR

Comments: Not Present

4.17 STEPS, STAIRWAYS AND RAILINGS**Comments: Not Present**

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

5(A) . Breakfast Area

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.



Styles & Materials

Floor Covering(s):

Vinyl

Wall Material:

Drywall

Ceiling Materials:

Drywall

Ceiling Fan:

No

Interior Doors:

Hollow core
Thermo/Slider

Window Types:

Thermal/Insulated

Smoke Detectors:

No

Heat Source:

Yes

Items

5.0.A WINDOWS (REPRESENTATIVE NUMBER)

Comments: Inspected

5.1.A WALLS

Comments: Inspected

5.2.A DOORS (REPRESENTATIVE NUMBER)

Comments: Inspected

5.3.A FLOORS

Comments: Inspected

5.4.A CEILING

Comments: Inspected

5.5.A CEILING FAN

Comments: Not Present

5.6.A STEPS, STAIRWAYS, BALCONIES AND RAILINGS

Comments: Not Present

5.7.A OUTLETS SWITCHES AND FIXTURES

Comments: Inspected

5.8.A SMOKE ALARMS

Comments: Not Present

5.9.A FIREPLACE/WOODBURNER

Comments: Not Present

5.10.A CABINETS

Comments: Inspected


The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

Window Safety Warning Two-thirds of falling injuries occurred among children younger than 5. This is the age group that's mobile, curious and does not recognize the danger of falling from a window. The study, appearing in the journal Pediatrics, is the first nationally representative study of such injuries. Researchers analyzed data from emergency departments from 1990 through 2008. An estimated 98,415 children were hurt during that time. Fewer than 1 percent of the cases led to deaths, but the researchers said the tally likely underestimated fatalities because not all children who die from their injuries are brought to the hospital. Summer months, when windows are left open, saw the highest number of injuries. One- and two-story falls made up 94 percent of the cases where the height of the fall was recorded. Injury rates declined slightly over the 19 years, about 4 percent, almost entirely in the under-5 age group. The average yearly injury rate was about 7 injuries per 100,000 children. Increased awareness of the danger, improved window construction and the use of window guards â bars that allow windows to open but keep children from falling â could explain the decrease. New York City requires window guards in apartments with children 10 and younger. Window guards cost about \$20 to \$40 per window. A quick release feature allows escape from a fire or other emergency. Parents also should move furniture away from windows and open windows from the top, if possible. Over 5,000 children a year being rushed to emergency departments because of falls from windows.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

5(B) . Mud Room

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

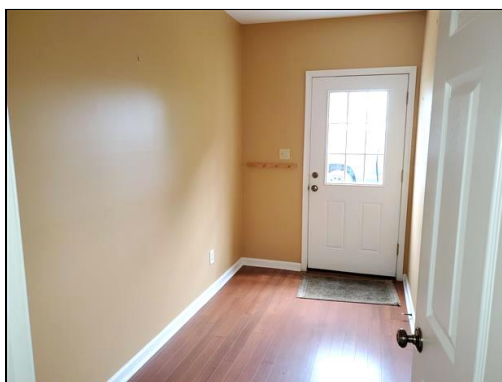

Styles & Materials

Floor Covering(s): Pergo Type	Wall Material: Drywall	Ceiling Materials: Drywall
Ceiling Fan: No	Interior Doors: Hollow core Metal	Window Types: None
Smoke Detectors: No	Heat Source: Yes	

Items

5.0.B WINDOWS (REPRESENTATIVE NUMBER)


Comments: Not Present

5.1.B WALLS

Comments: Inspected

5.2.B DOORS (REPRESENTATIVE NUMBER)

Comments: Repair or Replace


 Hollowcore door in the mudroom is binding in the door frame. Recommend to adjust door as needed to restore proper door function by a qualified person.



5.2.B Item 1(Picture)

5.3.B FLOORS

Comments: Inspected

 Typical warped pergo floor from minor water penetration. FYI This is located in the mudroom.



5.3.B Item 1(Picture)

5.4.B CEILING

Comments: Inspected

5.5.B CEILING FAN

Comments: Not Present

5.6.B STEPS, STAIRWAYS, BALCONIES AND RAILINGS

Comments: Not Present

5.7.B OUTLETS SWITCHES AND FIXTURES

Comments: Inspected

5.8.B SMOKE ALARMS

Comments: Not Present

5.9.B FIREPLACE/WOODBURNER

Comments: Not Present




The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

Window Safety Warning Two-thirds of falling injuries occurred among children younger than 5. This is the age group that's mobile, curious and does not recognize the danger of falling from a window. The study, appearing in the journal Pediatrics, is the first nationally representative study of such injuries. Researchers analyzed data from emergency departments from 1990 through 2008. An estimated 98,415 children were hurt during that time. Fewer than 1 percent of the cases led to deaths, but the researchers said the tally likely underestimated fatalities because not all children who die from their injuries are brought to the hospital. Summer months, when windows are left open, saw the highest number of injuries. One- and two-story falls made up 94 percent of the cases where the height of the fall was recorded. Injury rates declined slightly over the 19 years, about 4 percent, almost entirely in the under-5 age group. The average yearly injury rate was about 7 injuries per 100,000 children. Increased awareness of the danger, improved window construction and the use of window guards â bars that allow windows to open but keep children from falling â could explain the decrease. New York City requires window guards in apartments with children 10 and younger. Window guards cost about \$20 to \$40 per window. A quick release feature allows escape from a fire or other emergency. Parents also should move furniture away from windows and open windows from the top, if possible. Over 5,000 children a year being rushed to emergency departments because of falls from windows.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

5(C) . Foyer

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

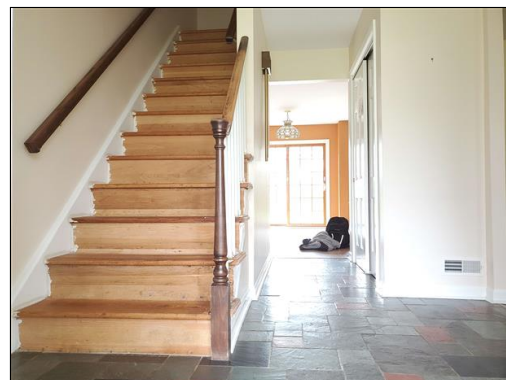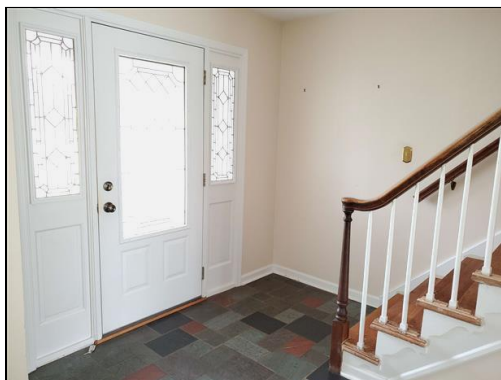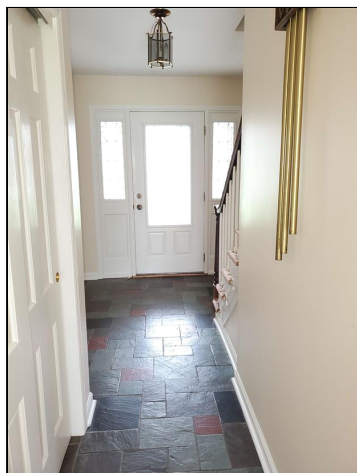

Styles & Materials

Floor Covering(s):

Wood
Stone

Wall Material:

Drywall

Ceiling Materials:

Drywall

Ceiling Fan:

No

Interior Doors:

Hollow core
Metal

Window Types:

Window Lights

Smoke Detectors:

Yes

Heat Source:

Yes

Items

5.0.C WINDOWS (REPRESENTATIVE NUMBER)

Comments: Inspected

5.1.C WALLS

Comments: Inspected

5.2.C DOORS (REPRESENTATIVE NUMBER)

Comments: Inspected

5.3.C FLOORS

Comments: Inspected

5.4.C CEILING

Comments: Inspected

5.5.C CEILING FAN


Comments: Not Present

5.6.C STEPS, STAIRWAYS, BALCONIES AND RAILINGS

Comments: Inspected

5.7.C OUTLETS SWITCHES AND FIXTURES

Comments: Repair or Replace


 Exterior light fixture was nonfunctional. Recommend to replace the bulb and test for function.



5.7.C Item 1(Picture)

5.8.C SMOKE ALARMS

Comments: Inspected

 Recommend to replace all older smoke detectors as discussed. Lifespan for smoke detectors is approximately 10 years. FYI

5.9.C FIREPLACE/WOODBURNER

Comments: Not Present

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

Window Safety Warning Two-thirds of falling injuries occurred among children younger than 5. This is the age group that's mobile, curious and does not recognize the danger of falling from a window. The study, appearing in the journal Pediatrics, is the first nationally representative study of such injuries. Researchers analyzed data from emergency departments from 1990 through 2008. An estimated 98,415 children were hurt during that time. Fewer than 1 percent of the cases led to deaths, but the researchers said the tally likely underestimated fatalities because not all children who die from their injuries are brought to the hospital. Summer months, when windows are left open, saw the highest number of injuries. One- and two-story falls made up 94 percent of the cases where the height of the fall was recorded. Injury rates declined slightly over the 19 years, about 4 percent, almost entirely in the under-5 age group. The average yearly injury rate was about 7 injuries per 100,000 children. Increased awareness of the danger, improved window construction and the use of window guards â bars that allow windows to open but keep children from falling â could explain the decrease. New York City requires window guards in apartments with children 10 and younger. Window guards cost about \$20 to \$40 per window. A quick release feature allows escape from a fire or other emergency. Parents also should move furniture away from windows and open windows from the top, if possible. Over 5,000 children a year being rushed to emergency departments because of falls from windows.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

5(D) . Living Room

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.



Styles & Materials

Floor Covering(s):

Pergo Type

Wall Material:

Drywall

Ceiling Materials:

Drywall

Ceiling Fan:

No

Interior Doors:

None

Window Types:

Double pane

Smoke Detectors:

No

Heat Source:

Yes

Items

5.0.D WINDOWS (REPRESENTATIVE NUMBER)

Comments: Inspected

5.1.D WALLS

Comments: Inspected

5.2.D DOORS (REPRESENTATIVE NUMBER)

Comments: Not Present

5.3.D FLOORS

Comments: Inspected

5.4.D CEILING

Comments: Inspected

5.5.D CEILING FAN

Comments: Not Present

5.6.D STEPS, STAIRWAYS, BALCONIES AND RAILINGS

Comments: Not Present

5.7.D OUTLETS SWITCHES AND FIXTURES

Comments: Inspected

5.8.D SMOKE ALARMS

Comments: Not Present

5.9.D FIREPLACE/WOODBURNER

Comments: Not Present

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

Window Safety Warning Two-thirds of falling injuries occurred among children younger than 5. This is the age group that's mobile, curious and does not recognize the danger of falling from a window. The study, appearing in the journal Pediatrics, is the first nationally representative study of such injuries. Researchers analyzed data from emergency departments from 1990 through 2008. An estimated 98,415 children were hurt during that time. Fewer than 1 percent of the cases led to deaths, but the researchers said the tally likely underestimated fatalities because not all children who die from their injuries are brought to the hospital. Summer months, when windows are left open, saw the highest number of injuries. One- and two-story falls made up 94 percent of the cases where the height of the fall was recorded. Injury rates declined slightly over the 19 years, about 4 percent, almost entirely in the under-5 age group. The average yearly injury rate was about 7 injuries per 100,000 children. Increased awareness of the danger, improved window construction and the use of window guards â bars that allow windows to open but keep children from falling â could explain the decrease. New York City requires window guards in apartments with children 10 and younger. Window guards cost about \$20 to \$40 per window. A quick release feature allows escape from a fire or other emergency. Parents also should move furniture away from windows and open windows from the top, if possible. Over 5,000 children a year being rushed to emergency departments because of falls from windows.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

5(E) . Family Room

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.



Styles & Materials

Floor Covering(s):

Pergo Type

Wall Material:

Drywall

Ceiling Materials:

Drywall

Ceiling Fan:

No

Interior Doors:

Thermo/Slider

Window Types:

Thermal/Insulated

Smoke Detectors:

Yes

Heat Source:

Yes


Items

5.0.E WINDOWS (REPRESENTATIVE NUMBER)

Comments: Inspected

5.1.E WALLS

Comments: Repair or Replace

 Water damaged wall in the family room. Suggest to repair gap and downspout on the exterior and repair wall as needed by a qualified person.




5.1.E Item 1(Picture)

5.2.E DOORS (REPRESENTATIVE NUMBER)

Comments: Inspected

5.3.E FLOORS

Comments: Inspected

 Typical warped pergo floor from minor water penetration. FYI This is located in the family room.



5.3.E Item 1(Picture)



5.3.E Item 2(Picture)

5.4.E CEILING

Comments: Inspected

5.5.E CEILING FAN

Comments: Not Present

5.6.E STEPS, STAIRWAYS, BALCONIES AND RAILINGS

Comments: Not Present

5.7.E OUTLETS SWITCHES AND FIXTURES

Comments: Repair or Replace



Nonfunctional recessed light fixture in the family room. Recommend to replace the bulb and test for function.



5.7.E Item 1(Picture)

5.8.E SMOKE ALARMS

Comments: Inspected



Recommend to replace all older smoke detectors as discussed. Lifespan for smoke detectors is approximately 10 years. FYI



5.8.E Item 1(Picture)

5.9.E FIREPLACE/WOODBURNER

Comments: Inspected



Fireplace appeared to be in good condition on the day of the inspection. Recommend to have chimney cleaned and inspected by a qualified chimney sweep before using.

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

Window Safety Warning Two-thirds of falling injuries occurred among children younger than 5. This is the age group that's mobile, curious and does not recognize the danger of falling from a window. The study, appearing in the journal Pediatrics, is the first nationally representative study of such injuries. Researchers analyzed data from emergency departments from 1990 through 2008. An estimated 98,415 children were hurt during that time. Fewer than 1 percent of the cases led to deaths, but the researchers said the tally likely underestimated fatalities because not all children who die from their injuries are brought to the hospital. Summer months, when windows are left open, saw the highest number of injuries. One- and two-story falls made up 94 percent of the cases where the height of the fall was recorded. Injury rates declined slightly over the 19 years, about 4 percent, almost entirely in the under-5 age group. The average yearly injury rate was about 7 injuries per 100,000 children. Increased awareness of the danger, improved window construction and the use of window guards â bars that allow windows to open but keep children from falling â could explain the decrease. New York City requires window guards in apartments with children 10 and younger. Window guards cost about \$20 to \$40 per window. A quick release feature allows escape from a fire or other emergency. Parents also should move furniture away from windows and open windows from the top, if possible. Over 5,000 children a year being rushed to emergency departments because of falls from windows.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

5(F) . Owners Suite

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.



Styles & Materials

Floor Covering(s):

Unfinished

Wall Material:

Drywall

Ceiling Materials:

Drywall

Ceiling Fan:

No

Interior Doors:

Hollow core

Window Types:

Double pane

Smoke Detectors:

Yes

Heat Source:

Yes

Items

5.0.F WINDOWS (REPRESENTATIVE NUMBER)

Comments: Inspected

5.1.F WALLS

Comments: Inspected

5.2.F DOORS (REPRESENTATIVE NUMBER)

Comments: Inspected

5.3.F FLOORS

Comments: Inspected



Bedroom floors were unfinished on the day of inspection. FYI

5.4.F CEILING

Comments: Inspected

5.5.F CEILING FAN

Comments: Not Present

5.6.F STEPS, STAIRWAYS, BALCONIES AND RAILINGS

Comments: Not Present

5.7.F OUTLETS SWITCHES AND FIXTURES

Comments: Inspected

5.8.F SMOKE ALARMS

Comments: Inspected



Recommend to replace all older smoke detectors as discussed. Lifespan for smoke detectors is approximately 10 years. FYI

5.9.F FIREPLACE/WOODBURNER

Comments: Not Present

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

Window Safety Warning Two-thirds of falling injuries occurred among children younger than 5. This is the age group that's mobile, curious and does not recognize the danger of falling from a window. The study, appearing in the journal Pediatrics, is the first nationally representative study of such injuries. Researchers analyzed data from emergency departments from 1990 through 2008. An estimated 98,415 children were hurt during that time. Fewer than 1 percent of the cases led to deaths, but the researchers said the tally likely underestimated fatalities because not all children who die from their injuries are brought to the hospital. Summer months, when windows are left open, saw the highest number of injuries. One- and two-story falls made up 94 percent of the cases where the height of the fall was recorded. Injury rates declined slightly over the 19 years, about 4 percent, almost entirely in the under-5 age group. The average yearly injury rate was about 7 injuries per 100,000 children. Increased awareness of the danger, improved window construction and the use of window guards â bars that allow windows to open but keep children from falling â could explain the decrease. New York City requires window guards in apartments with children 10 and younger. Window guards cost about \$20 to \$40 per window. A quick release feature allows escape from a fire or other emergency. Parents also should move furniture away from windows and open windows from the top, if possible. Over 5,000 children a year being rushed to emergency departments because of falls from windows.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

5(G) . Bedroom #2

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.



Styles & Materials

Floor Covering(s):

Unfinished

Wall Material:

Drywall

Ceiling Materials:

Drywall

Ceiling Fan:

No

Interior Doors:

Wood

Window Types:

Double pane

Smoke Detectors:

Yes

Heat Source:

Yes

Items

5.0.G WINDOWS (REPRESENTATIVE NUMBER)


Comments: Inspected

5.1.G WALLS

Comments: Inspected

5.2.G DOORS (REPRESENTATIVE NUMBER)

Comments: Repair or Replace


 Bedroom #2 entrance door is missing a striker plate. Recommend to install a striker plate as needed by a qualified person.



5.2.G Item 1(Picture)

5.3.G FLOORS

Comments: Inspected

 Bedroom floors were unfinished on the day of inspection. FYI

5.4.G CEILING

Comments: Inspected

5.5.G CEILING FAN

Comments: Not Present

5.6.G STEPS, STAIRWAYS, BALCONIES AND RAILINGS


Comments: Not Present

5.7.G OUTLETS SWITCHES AND FIXTURES

Comments: Inspected

5.8.G SMOKE ALARMS

Comments: Inspected

 Recommend to replace all older smoke detectors as discussed. Lifespan for smoke detectors is approximately 10 years. FYI

5.9.G FIREPLACE/WOODBURNER

Comments: Not Present

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

Window Safety Warning Two-thirds of falling injuries occurred among children younger than 5. This is the age group that's mobile, curious and does not recognize the danger of falling from a window. The study, appearing in the journal Pediatrics, is the first nationally representative study of such injuries. Researchers analyzed data from emergency departments from 1990 through 2008. An estimated 98,415 children were hurt during that time. Fewer than 1 percent of the cases led to deaths, but the researchers said the tally likely underestimated fatalities because not all children who die from their injuries are brought to the hospital. Summer months, when windows are left open, saw the highest number of injuries. One- and two-story falls made up 94 percent of the cases where the height of the fall was recorded. Injury rates declined slightly over the 19 years, about 4 percent, almost entirely in the under-5 age group. The average yearly injury rate was about 7 injuries per 100,000 children. Increased awareness of the danger, improved window construction and the use of window guards "bars that allow windows to open but keep children from falling" could explain the decrease. New York City requires window guards in apartments with children 10 and younger. Window guards cost about \$20 to \$40 per window. A quick release feature allows escape from a fire or other emergency. Parents also should move furniture away from windows and open windows from the top, if possible. Over 5,000 children a year being rushed to emergency departments because of falls from windows.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

5(H) . Bedroom #3

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.



Styles & Materials

Floor Covering(s):

Unfinished

Wall Material:

Drywall

Ceiling Materials:

Drywall

Ceiling Fan:

No

Interior Doors:

Wood

Window Types:

Double pane

Smoke Detectors:

Yes

Heat Source:

Yes

Items

5.0.H WINDOWS (REPRESENTATIVE NUMBER)

Comments: Inspected

5.1.H WALLS

Comments: Inspected

5.2.H DOORS (REPRESENTATIVE NUMBER)

Comments: Inspected

5.3.H FLOORS

Comments: Inspected



Bedroom floors were unfinished on the day of inspection. FYI

5.4.H CEILING

Comments: Inspected

5.5.H CEILING FAN

Comments: Not Present

5.6.H STEPS, STAIRWAYS, BALCONIES AND RAILINGS

Comments: Not Present

5.7.H OUTLETS SWITCHES AND FIXTURES

Comments: Inspected

5.8.H SMOKE ALARMS

Comments: Inspected



Recommend to replace all older smoke detectors as discussed. Lifespan for smoke detectors is approximately 10 years. FYI

5.9.H FIREPLACE/WOODBURNER

Comments: Not Present

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

Window Safety Warning Two-thirds of falling injuries occurred among children younger than 5. This is the age group that's mobile, curious and does not recognize the danger of falling from a window. The study, appearing in the journal Pediatrics, is the first nationally representative study of such injuries. Researchers analyzed data from emergency departments from 1990 through 2008. An estimated 98,415 children were hurt during that time. Fewer than 1 percent of the cases led to deaths, but the researchers said the tally likely underestimated fatalities because not all children who die from their injuries are brought to the hospital. Summer months, when windows are left open, saw the highest number of injuries. One- and two-story falls made up 94 percent of the cases where the height of the fall was recorded. Injury rates declined slightly over the 19 years, about 4 percent, almost entirely in the under-5 age group. The average yearly injury rate was about 7 injuries per 100,000 children. Increased awareness of the danger, improved window construction and the use of window guards â bars that allow windows to open but keep children from falling â could explain the decrease. New York City requires window guards in apartments with children 10 and younger. Window guards cost about \$20 to \$40 per window. A quick release feature allows escape from a fire or other emergency. Parents also should move furniture away from windows and open windows from the top, if possible. Over 5,000 children a year being rushed to emergency departments because of falls from windows.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

5(I) . Bedroom #4

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.



Styles & Materials

Floor Covering(s):

Unfinished

Wall Material:

Drywall

Ceiling Materials:

Drywall

Ceiling Fan:

No

Interior Doors:

Wood

Window Types:

Double pane

Smoke Detectors:

Yes

Heat Source:

Yes


Items

5.0.I WINDOWS (REPRESENTATIVE NUMBER)

Comments: Inspected

5.1.I WALLS

Comments: Repair or Replace

 Unfinished drywall in bedroom #4 closet. Recommend to repair or install a door as needed by a qualified person or professional.




5.1.I Item 1(Picture)

5.2.I DOORS (REPRESENTATIVE NUMBER)

Comments: Inspected

5.3.I FLOORS

Comments: Inspected

 Bedroom floors were unfinished on the day of inspection. FYI

5.4.I CEILING

Comments: Inspected

5.5.I CEILING FAN

Comments: Not Present

5.6.I STEPS, STAIRWAYS, BALCONIES AND RAILINGS


Comments: Not Present

5.7.I OUTLETS SWITCHES AND FIXTURES

Comments: Inspected

5.8.I SMOKE ALARMS

Comments: Inspected

 Recommend to replace all older smoke detectors as discussed. Lifespan for smoke detectors is approximately 10 years. FYI

5.9.I FIREPLACE/WOODBURNER

Comments: Not Present

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

Window Safety Warning Two-thirds of falling injuries occurred among children younger than 5. This is the age group that's mobile, curious and does not recognize the danger of falling from a window. The study, appearing in the journal Pediatrics, is the first nationally representative study of such injuries. Researchers analyzed data from emergency departments from 1990 through 2008. An estimated 98,415 children were hurt during that time. Fewer than 1 percent of the cases led to deaths, but the researchers said the tally likely underestimated fatalities because not all children who die from their injuries are brought to the hospital. Summer months, when windows are left open, saw the highest number of injuries. One- and two-story falls made up 94 percent of the cases where the height of the fall was recorded. Injury rates declined slightly over the 19 years, about 4 percent, almost entirely in the under-5 age group. The average yearly injury rate was about 7 injuries per 100,000 children. Increased awareness of the danger, improved window construction and the use of window guards "bars that allow windows to open but keep children from falling" could explain the decrease. New York City requires window guards in apartments with children 10 and younger. Window guards cost about \$20 to \$40 per window. A quick release feature allows escape from a fire or other emergency. Parents also should move furniture away from windows and open windows from the top, if possible. Over 5,000 children a year being rushed to emergency departments because of falls from windows.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

6(A) . 1/2 Bath

All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.



Styles & Materials

Exhaust Fans:

Fan

Window Types:

None

Floor Covering(s):

Vinyl

GFI Receptacles:

Yes

Items

6.0.A WINDOWS

Comments: Not Present

6.1.A DOORS (REPRESENTATIVE NUMBER)

Comments: Inspected

6.2.A WALLS

Comments: Inspected

6.3.A FLOORS


Comments: Inspected

6.4.A CEILING

Comments: Inspected

6.5.A OUTLETS SWITCHES AND FIXTURES

Comments: Repair or Replace

 Nonfunctional GFI receptacle in the 1/2 bath. Recommend to replace nonfunctional GFI receptacle as needed by a qualified electrician. Potential safety hazard exist.



6.5.A Item 1(Picture)

6.6.A EXHAUST FAN

Comments: Inspected

6.7.A COUNTERS AND A REPRESENTATIVE NUMBER OF CABINETS


Comments: Inspected

6.8.A PLUMBING WATER SUPPLY AND DISTRIBUTION SYSTEMS AND FIXTURES

Comments: Inspected

6.9.A PLUMBING DRAIN, WASTE AND VENT SYSTEMS

Comments: Repair or Replace

 The toilet is loose at floor at the 1/2 bath. Recommend to secure toilet the the floor as needed by a qualified person or plumber.



6.9.A Item 1(Picture)

One-third of all falls that happen at home occur in the bath room. Everybody in your family is at risk, regardless of age or health. Recommend to use all appropriate safety devices as needed such as grab bars, non-slip floor tiles and non-slip tub and shower floor surfaces.

Grab bars. Install at least one grab bar in a bathtub or shower. Some recommended locations include: STALL SHOWERS (one horizontal bar on the service wall to facilitate movement within the enclosure) TUB/SHOWER UNITS (one horizontal bar centered on the service wall and a vertical bar near the outside edge where bathers enter and exit.)

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

6(B) . Hall Bath

All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.



Styles & Materials

Exhaust Fans:

None

Window Types:

Double Pane Windows

Floor Covering(s):

Vinyl

GFI Receptacles:

No

Items

6.0.B WINDOWS

Comments: Inspected

6.1.B DOORS (REPRESENTATIVE NUMBER)

Comments: Inspected


6.2.B WALLS

Comments: Inspected

6.3.B FLOORS

Comments: Inspected

 Damaged vinyl floor in the hall bath. Recommend to repair or replace flooring as needed by a qualified person or professional.

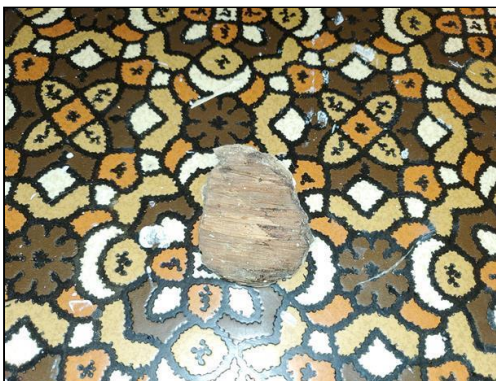

6.3.B Item 1(Picture)

6.4.B CEILING

Comments: Inspected

6.5.B OUTLETS SWITCHES AND FIXTURES

Comments: Repair or Replace

🔧 No GFI receptacles are located in the hall bath room. Recommend to install GFI receptacles as needed by a qualified person. This would be considered an added safety precaution against a potential severe electrical shock.



6.5.B Item 1(Picture)

6.6.B EXHAUST FAN

Comments: Not Present

6.7.B COUNTERTOPS AND A REPRESENTATIVE NUMBER OF CABINETS

Comments: Inspected

6.8.B PLUMBING WATER SUPPLY AND DISTRIBUTION SYSTEMS AND FIXTURES

Comments: Repair or Replace

🚿 Shower diverter valve in the hall bath is not functioning properly. Recommend to replace diverter valve as needed by a qualified plumber.



6.8.B Item 1(Picture)

6.9.B PLUMBING DRAIN, WASTE AND VENT SYSTEMS


Comments: Repair or Replace



Toilet in the hall bath very loose and nonfunctional. Recommend to repair as needed by a qualified plumber.



6.9.B Item 1(Picture)

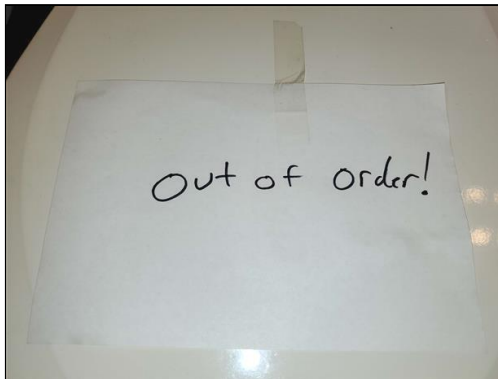

6.9.B Item 2(Picture)

6.10.B TUB AND SHOWER

Comments: Inspected

6.11.B WHIRLPOOL TUB

Comments: Not Present

One-third of all falls that happen at home occur in the bath room. Everybody in your family is at risk, regardless of age or health. Recommend to use all appropriate safety devices as needed such as grab bars, non-slip floor tiles and non-slip tub and shower floor surfaces.

Grab bars. Install at least one grab bar in a bathtub or shower. Some recommended locations include: STALL SHOWERS (one horizontal bar on the service wall to facilitate movement within the enclosure) TUB/SHOWER UNITS (one horizontal bar centered on the service wall and a vertical bar near the outside edge where bathers enter and exit.)

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

6(C) . Owners Suite Bath

All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.



Styles & Materials

Exhaust Fans:

Fan with light

Window Types:

Thermal/Insulated

Floor Covering(s):

Vinyl

GFI Receptacles:

Yes


Items

6.0.C WINDOWS

Comments: Inspected

6.1.C DOORS (REPRESENTATIVE NUMBER)

Comments: Repair or Replace

 Door hardware in the owners' suite bath is not latching properly. Recommend to adjust or repair hardware as needed by a qualified person.



6.1.C Item 1(Picture)

6.2.C WALLS

Comments: Inspected

6.3.C FLOORS

Comments: Inspected

6.4.C CEILING

Comments: Inspected

6.5.C OUTLETS SWITCHES AND FIXTURES

Comments: Inspected

6.6.C EXHAUST FAN

Comments: Inspected

6.7.C COUNTERS AND A REPRESENTATIVE NUMBER OF CABINETS

Comments: Inspected

6.8.C PLUMBING WATER SUPPLY AND DISTRIBUTION SYSTEMS AND FIXTURES

Comments: Inspected

6.9.C PLUMBING DRAIN, WASTE AND VENT SYSTEMS

Comments: Inspected

6.10.C TUB AND SHOWER

Comments: Inspected

6.11.C WHIRLPOOL TUB

Comments: Not Present

One-third of all falls that happen at home occur in the bath room. Everybody in your family is at risk, regardless of age or health. Recommend to use all appropriate safety devices as needed such as grab bars, non-slip floor tiles and non-slip tub and shower floor surfaces.

Grab bars. Install at least one grab bar in a bathtub or shower. Some recommended locations include: STALL SHOWERS (one horizontal bar on the service wall to facilitate movement within the enclosure) TUB/SHOWER UNITS (one horizontal bar centered on the service wall and a vertical bar near the outside edge where bathers enter and exit.)

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

7. Laundry Area

All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.



Styles & Materials

Window Types:

None

Interior Doors:

None

Washer:

Yes

Dryer:

Yes

Utility Sink:

No

Heat Source:

No

Items

7.0 WINDOWS (REPRESENTATIVE NUMBER)

Comments: Not Present

7.1 DOORS

Comments: Not Present

7.2 WALLS

Comments: Inspected

7.3 FLOOR

Comments: Inspected

7.4 CEILINGS

Comments: Inspected

7.5 OUTLETS SWITCHES AND FIXTURES

Comments: Inspected

7.6 WASHER AND DRYER CONNECTIONS

Comments: Inspected



Suggest to replace rubber washing machine hose with stainless steel braided burst proof hose. This would be considered optional.



7.6 Item 1(Picture)

7.7 WASHER

Comments: Inspected

7.8 DRYER

Comments: Inspected

7.9 UTILITY SINK

Comments: Not Present

7.10 CABINETS

Comments: Not Present

#1 cause of house fires in the country is due to DRYER VENT LINT. Recommend that the entire clothes dryer venting system be cleaned of the accumulated lint on a regular basis. Dryer vent lint build-up is known to be a FIRE HAZARD. Highly recommend to install a smoke detector in the laundry area as an added safety precaution from a potential fire.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

8. Electrical System

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.



Styles & Materials

Electric Turned On:

Yes

Electrical Service Conductors:

Below ground

Panel capacity:

200 AMP

Panel Type:

Circuit breakers

Electric Panel Manufacturer:

SIEMENS

Branch wire 15 and 20 AMP:

Copper


Wiring Methods:

Romex

Items

8.0 SERVICE ENTRANCE CONDUCTORS

Comments: Repair or Replace


 Main electrical line is frayed and deteriorated and in need of replacement. Recommend to replace main power line as needed by a qualified electrician. Potential safety hazard exist.



8.0 Item 1(Picture)

8.1 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

Comments: Repair or Replace

 Ground wire must be attached to both sides of the water meter. Attach as needed by a qualified professional.



8.1 Item 1(Picture)



8.1 Item 2(Picture)

8.2 BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATIBILITY OF THEIR AMPERAGE AND VOLTAGE

Comments: Inspected

8.3 CONNECTED DEVICES AND FIXTURES (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls)


Comments: Inspected

8.4 POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, AND ALL RECEPTACLES IN GARAGE, CARPORT, EXTERIOR WALLS OF INSPECTED STRUCTURE

Comments: Inspected


8.5 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)

Comments: Inspected

 See other comments about GFI's located in other sections of the report.


8.6 LOCATION OF MAIN AND DISTRIBUTION PANELS

Comments: Inspected

 The main panel box is located in the basement.

8.7 SMOKE DETECTORS

Comments: Inspected

 Recommend to install smoke detectors as suggested by the Fire Protection Association.

Smoke Detector Recommendations (Fire Protection Association)

The **Fire Protection Association recommends** detectors in every room in the house. The simplest rule for locating a basic smoke detector is mount it between the bedrooms and the rest of the house, but closer to the bedrooms. It is better, however, to install multiple detectors and put one near each sleeping area. In multilevel homes, install one on each level. The basement ceiling, near the steps, is a good location for extra protection. But for the best protection, locate a detector in each bedroom. Detectors have additional features to help in warning the family of fire danger and to help them escape from the house. Some are equipped with lights and are suggested for halls and stairways and any location leading to doors or windows. The idea is to light the escape route. Others have loud sirens to awaken sleeping persons or extra loud horns for use in homes where there are persons with hearing impairment.


Install each detector on the ceiling or on walls between 6" and 12" below the ceiling. Do not put it within 6" of where the wall and ceiling meet on either surface. This is dead air space with little circulation. Do not mount a detector in front of an air supply or return duct.

Test smoke detectors at least once a month.

Replace smoke detector batteries at least annually, such as when resetting clocks in the fall or spring.

8.8 CARBON MONOXIDE DETECTORS

Comments: Not Present

 There is no carbon monoxide detector found in home. It is recommended that carbon monoxide detectors be installed according to the manufacturer's instructions. Potential safety hazard exists.

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

Circuit Breakers & Fuses

- **If your home has circuit breakers, know how to reset them. After turning off or unplugging appliances on the circuit, push the switch firmly to the OFF position, then back to ON. If the overload is cleared, the electricity will come back on.**
- **To replace a blown fuse, turn off the appliances and lights you were using. Turn off the main switch on the fuse box. Check the fuses to find the blown fuse. Be sure to replace the blown fuse with the proper size, or you may cause a fire.**
- **If your circuit breakers trip off repeatedly, there could be a problem with the appliance(s) on that circuit. If the appliances are unplugged but the circuit breaker trips off again, call an electrician.**
- **If you continually replace fuses, reset circuit breakers, hear unusual buzzing sounds, see sparks or flickering lights, you may have a problem with the electrical wiring in your home. Contact a licensed electrical contractor to perform an inspection and make any necessary repairs.**

Always use the correct ampere rated fuses or circuit breakers. Incorrect amperage can cause power outages or fires in your home. If you do not know the correct size, have an electrician identify and label the sizes to be used.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

9. Plumbing System

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.



Styles & Materials

Water Turned On: Yes	Water Heater Manufacturer: BRADFORD-WHITE	Water Heater Power Source: Electric
Water Heater Capacity: 50 Gallon (2-3 people)	Water Source: Public	Plumbing Water Supply (into home): Copper
Plumbing Water Distribution (inside home): Copper	Plumbing Waste Line: Cast iron Copper PVC	Sump Pump: Yes
Fire Sprinkler System: No		

Items

9.0 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

Comments: Inspected

9.1 PLUMBING WATER SUPPLY AND DISTRIBUTION SYSTEMS AND FIXTURES

Comments: Inspected

9.2 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

Comments: Repair or Replace

Hot water expansion tank is water logged. Recommend to repair or replace expansion tank as needed by a qualified person or plumber.



9.2 Item 1(Picture)

9.3 MAIN WATER SHUT-OFF DEVICE (Describe location)

Comments: Inspected

The main shut off is the red knob located in the basement. This is for your information.



9.3 Item 1(Picture)

9.4 FUEL STORAGE AND DISTRIBUTION SYSTEMS (Interior fuel storage, piping, venting, supports, leaks)

Comments: Not Present

9.5 MAIN FUEL SHUT OFF (Describe Location)

Comments: Not Present


9.6 RADON SYSTEM


Comments: Not Present

[RADON INFORMATION](#) Recommend to view radon report when available.

9.7 SUMP PUMP

Comments: Repair or Replace

 Missing a cover on the sump pump. Recommend to install a coverplate as needed by a qualified person.

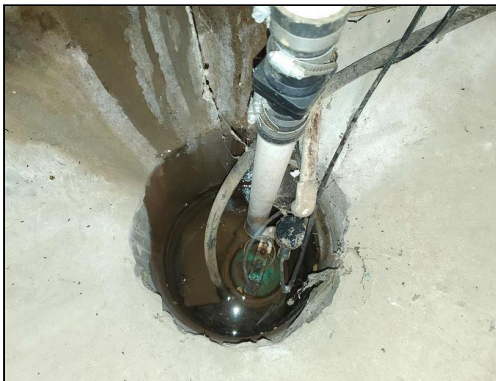

9.7 Item 1(Picture)

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. Recommend to have the waste line scoped with a camera prior to buying the house. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust, deposits within the pipes or tree roots can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

The do-it-yourself householder is subject to the same regulations and controls as the professional plumber and everything connected to water supply has to comply with statutory requirements. Minimum standards for sanitary plumbing and drainage installations are laid down by law in the interest of public health and safety. Noncompliance can lead to prosecution and the possible imposition of substantial fines.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

10. Heating / Central Air Conditioning

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.




Styles & Materials

Heat Type: Electric Base Heat Pump Forced Air (also provides cool air)	Energy Source: Electric	Number of Heat Systems (excluding wood): Three
Heat System Brand: RHEEM	Ductwork: Insulated	Filter Type: Disposable
Types of Fireplaces: Conventional wood burning with a wood burner insert	Cooling Equipment Type: Heat Pump Forced Air (also provides cold air)	Cooling Equipment Energy Source: Electricity
Central Air Manufacturer: RHEEM	Number of AC Only Units: Two	

Items

10.0 HEATING EQUIPMENT

Comments: Inspected

 Heating equipment was fully functional on the day of the inspection. For maximum efficiency and unit longevity suggest to have unit serviced on an annual basis. This would be considered normal maintenance.

Electric base heaters in bedroom #2, 3, 4 and hall bath are nonfunctional. FYI

10.1 NORMAL OPERATING CONTROLS


Comments: Inspected

10.2 AUTOMATIC SAFETY CONTROLS

Comments: Inspected

10.3 DISTRIBUTION SYSTEMS (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)

Comments: Inspected

 Air filter location. FYI




10.3 Item 1(Picture)

10.4 PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM

Comments: Inspected

10.5 CHIMNEYS, FLUES AND VENTS (for fireplaces, gas water heaters or heat systems)


Comments: Not Inspected

 The liner for the fireplace was not inspected by our company. I recommend a qualified chimney sweep clean and inspect for safety.

See chimney comments.

10.6 FIREPLACE/WOODBURNER

Comments: Not Inspected


 Fireplace appeared to be in good condition on the day of the inspection. Recommend to have chimney cleaned and inspected by a qualified chimney sweep before using.

10.7 GAS/LP FIRELOGS AND FIREPLACES

Comments: Not Present

10.8 COOLING AND AIR HANDLER EQUIPMENT

Comments: Repair or Replace


 (1) Foam freon line cover is deteriorated and damaged. Recommend to replace foam cover as needed for maximum cooling efficiency and unit longevity. Replace as needed by a qualified person.



10.8 Item 1(Picture)



10.8 Item 2(Picture)


 (2) Air-conditioning was not tested on the day of the inspection. Testing air conditioning in colder weather can do permanent damage to the air-conditioning system.

Suggest to have system checked before settlement if you have any concerns about system function.

The main obstacle in testing the A/C is the outdoor temperature. You should not operate an a/c unit (or heat pump in the cooling mode) when the outdoor temperature is below about 60°F or risk damaging or slugging the compressor. The problem is that the refrigerant may begin to condense (become liquid) within the compressor and damage or ruin the valves, piston, etc. Liquids are not compressible and the compressor is designed to compress gaseous refrigerant not liquid refrigerant.


10.9 NORMAL OPERATING CONTROLS

Comments: Not Inspected

 Air-conditioning was not tested on the day of the inspection. Testing air conditioning in colder weather 65 degrees or less can do permanent damage to the air-conditioning system.

10.10 PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM

Comments: Not Inspected

 Air-conditioning was not tested on the day of the inspection. Testing air conditioning in colder weather can do permanent damage to the air-conditioning system.

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

11. Structural Components

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.



Styles & Materials

Foundation:

Poured concrete

Method used to observe Crawlspace:

No crawlspace

Floor Structure:

2 X12
Slab

Wall Structure:

2 X 4 Wood

Columns or Piers:

Steel lally columns


Floor System Insulation:

Batts
Fiberglass
R-19

Items


11.0 FOUNDATIONS, BASEMENTS AND CRAWLSPACES (Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components.)

Comments: Repair or Replace

 Water penetration at the right side of the basement. Recommend to repair as needed to prevent further water penetration.

11.1 WINDOWS (REPRESENTATIVE NUMBER)

Comments: Repair or Replace


 Water penetration at the window well. Recommend to install window well covers to prevent further water penetration.



11.1 Item 1(Picture)

11.2 DOORS (REPRESENTATIVE NUMBER)

Comments: Inspected

 Recommend to install a door at the bottom of the steps. This will help prevent insect and rodent penetration. FYI




11.2 Item 1(Picture)

11.3 WALLS (Structural)

Comments: Repair or Replace

↑ (1) Area of water penetration on the wall in the basement. Recommend to patch or repair honeycombed area to prevent further water penetration. Suggest to use a hydraulic cement for repair. Also recommend to make sure downspout drain at corner of house is functional.

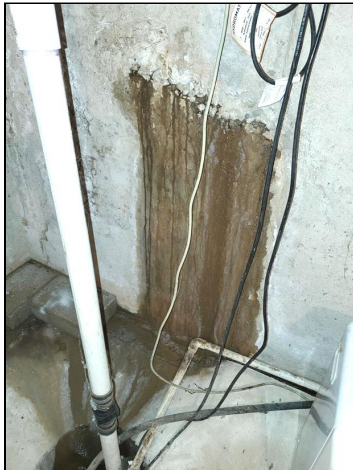

11.3 Item 1(Picture)



11.3 Item 2(Picture)

↑ (2) Minor water penetration in wall next to sewer and water lines. Recommend to verify downspout drains are functional.



11.3 Item 3(Picture)

↑ (3) Typical settlement crack located in the foundation wall. Recommend to seal crack as discussed using a hydraulic cement. This will enable you to monitor same area for potential further movement.



11.3 Item 4(Picture)

11.4 FLOORS (Structural)

Comments: Inspected

11.5 CEILINGS (structural)

Comments: Inspected

11.6 STEPS, STAIRWAYS, AND RAILINGS

Comments: Repair or Replace

📌 Missing guardrail at step area. Recommend to replace missing guardrail as needed by a qualified person. Potential safety hazard for small children exists.



11.6 Item 1(Picture)

11.7 COLUMNS OR PIERS

Comments: Inspected

11.8 INSULATION UNDER FLOOR SYSTEM

Comments: Repair or Replace

📌 Loose insulation in the basement ceiling. Recommend to secure as needed by a qualified person or professional.



11.8 Item 1(Picture)



11.8 Item 2(Picture)

11.9 VAPOR RETARDERS (ON GROUND IN CRAWLSPACE OR BASEMENT)

Comments: Inspected

11.10 VENTILATION OF FOUNDATION AREA (crawlspce or basement)

Comments: Inspected

📌 Ventilation was acceptable. Recommend to install a dehumidifier to prevent the formation of mold and mildew. Suggest to have a target setting of 45 to 50% relative humidity. This will help prevent the formation of mold and mildew.

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report. All work requiring permits from the township or local authorities should be checked and verified by the potential purchasing party before settlement. The home inspector is not required to check for permits or to see if work was completed as according to township or local authority regulations or specifications.

Unusual or extreme weather conditions can cause higher than normal ground water saturation. Abnormal water saturation can cause foundation issues such as settlement and structural damage. If such conditions exists suggest to inspect the foundation for structural damage. Also suggest to consult a professional contractor for further consultation.

All items listed in the report should be addressed as needed by the prospective buyer before settlement. Some unknown issues could exist if not checked by a qualified professional. Home inspector is not responsible for items not addressed before settlement. Home inspection was a non-invasive or visual inspection only.

12. IMPORTANT (Note to Buyer)

Note to Buyer: The PA Construction Code Act, and local codes establish standards for building and altering properties. Buyers should check with the municipality to determine if permits and/or approvals were necessary for disclosed work and if so, whether they were obtained. Where required permits were not obtained, the municipality might require the current owner to upgrade or remove changed made by the prior owners. Buyers can have the property inspected by an expert in code compliance to determine if issues exists. Expanded title insurance policies may be available for Buyers to cover the risk of work done to the property by previous owners without a permit or approval.

Note to Buyer: According to the PA Stormwater Management Act, each municipality must enact a Storm Water Management Plan for drainage control and flood reduction. The municipality where the property is located may impose restrictions on impervious or semi-pervious surfaces added to the property. Buyers should contact the local office charged with overseeing the Stormwater Management Plan to determine if the proper addition of impervious or semi-pervious areas, such as walkways, decks, and swimming pools, might affect your ability to make future changes.

Note to Buyer: if seller becomes aware of additional information about the property, including through inspection reports from a buyer, the seller must update the Seller's Property Disclosure Statement and/or attach the inspection(s). These inspection reports are for informational purposes only.

13. Report Conclusion

Thank you for allowing me to perform your inspection. I trust that you will be happy with the quality of my work. I have made every effort to provide you with an accurate assessment of the condition of the property and its components and to alert you to any significant defects or adverse conditions.

However, I have not tested every outlet, opened every window and door, or identified every minor defect. Also because I am not a specialist and because my inspection is essentially visual, latent defects could exist.

As an owner, you should expect problems to occur. For example, roofs will leak, drain lines will become blocked, and components and systems will fail without warning. For these reasons, you should take into consideration the age of the house and its components and keep a comprehensive insurance policy current.

Thank you for taking the time to read this report. I strive to provide high quality services while continuing to adhere to the highest ethical standards of our profession.

As a client, you are welcome to call at any time for advice or consultation regarding this property. I appreciate the trust you have placed in me and hope that you will feel confident in referring your family and friends to us when inspection services are needed.

14. ASHI Inspection Regulations

[ASHI Inspection Regulations](#)

15. Lead Based Paint Law

Lead based paint was in use until approximately 1978. According to the Federal Department of Housing and Urban Development, a lead hazard can be present in a house of this age. Due to a recent Lead Law that has been enacted in April 2010, any contracting work that is performed on both the interior and exterior of the home will need to be performed by a lead safe working practice certified contractor. You can visit the EPA website for more information <http://www.epa.gov/lead/index.html>. **An evaluation of lead in paint is beyond the scope of this inspection.**

16. Government Mold Information

[Mold Websit](#)

17. Government Radon Information

[Government Radon Websit](#)

General Summary



A1 House Prep LLC and Inspections

**340 Freed Road
Harleysville, Pa 19438
215-853-8226**

Customer
Matthew Missimer

Address
552 Colonial Ave
Souderton Pa 18964

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

1. Roofing / Chimneys / Roof Structure and Attic

1.0 ***** ROOF VIDEO *****

Inspected



[ROOF VIDEO](#)

Suggest to view roof video for more information.



1.0 Item 1(Video) *** ROOF VIDEO ***

1.1 ROOF COVERINGS

Repair or Replace



(1)

- Lower roof has signs of wear and tear and patched nail holes. Projected life span on lower roof; 5-7 years remaining with proper maintenance.
- Upper back roof appears newer and is in very good condition.

Recommend to view roof video for more information. FYI




1.1 Item 1(Picture)



1.1 Item 2(Picture)



1.1 Item 3(Picture)

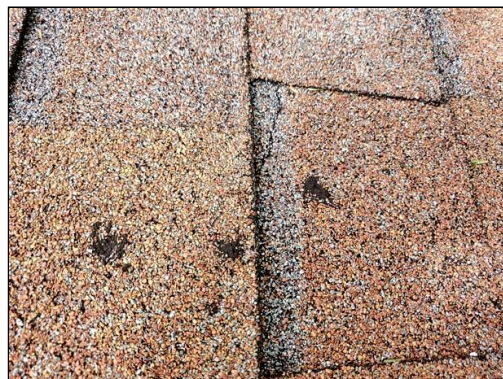

1.1 Item 4(Picture)



(2) The tree limbs that are in contact with roof or hanging near roof should be trimmed.



1.1 Item 5(Picture)



(3) Shed roof is at the end of its' projected lifespan. Recommend to replace shed roof as needed by a qualified professional.



1.1 Item 6(Picture)



1.1 Item 7(Picture)

1.3 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

Repair or Replace



Cracked flue pipe. Recommend to repair or replace as needed by a qualified professional.



1.3 Item 1(Picture)



1.3 Item 2(Picture)

1.4 ROOF DRAINAGE SYSTEMS (gutters and downspouts)

Repair or Replace



(1) Downspouts are not moving water effectively away from the foundation. Suggest to extend downspouts as discussed for better drainage away from the foundation. Saturating foundation walls for extended periods of time can cause potential unseen structural damage from water and insects. Could not determine how long water was flowing towards the foundation.



1.4 Item 1(Picture)



(2) Gutters appear to be working properly. Could not verify condition of the downspouts and drains. Suggest to verify condition of all downspout drains as needed. Many basement leaks occur from clogged downspout drains.



1.4 Item 2(Picture)



1.4 Item 3(Picture)

1.7 ROOF STRUCTURE AND ATTIC (Report leak signs or condensation)

Inspected




No signs of present water penetration or condensation in the attic area on the day of the inspection.

1.11 STEPS, STAIRWAYS AND RAILINGS

Repair or Replace



Bent bracket at the pull down stairs. Recommend to repair as needed by a qualified person.

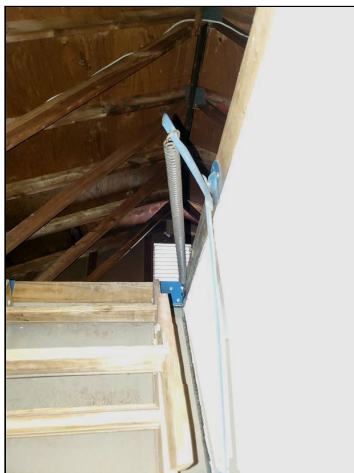

1.11 Item 1(Picture)

2. Exterior

2.0 WALL CLADDING FLASHING AND TRIM

Repair or Replace



(1) Loose siding at the right and left side of the house. Recommend to secure siding as needed by a qualified professional.



2.0 Item 1(Picture)



2.0 Item 2(Picture)



2.0 Item 3(Picture)



(2) Deteriorated wood siding at the bottom of shed and interior walls. Recommend to repair or replace deteriorated wood as needed by a qualified person or professional.



2.0 Item 4(Picture)



2.0 Item 5(Picture)



2.0 Item 6(Picture)



(3) The hole in siding needs closing off with sealant or liquid foam at the exterior where compressor lines enter the home in the attic. Potential for insect penetration.



2.0 Item 7(Picture)

2.1 WINDOWS

Inspected



Missing a window well covers. Suggest to install clear plastic well covers over window wells to prevent potential well saturation which could overflow window sill and spill into the basement. **This is considered optional.**



2.1 Item 1(Picture)



2.1 Item 2(Picture)

2.3 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (With respect to their effect on the condition of the building)

Repair or Replace



(1) Rotated and uneven concrete walkway. Recommend to repair as needed by a qualified person or professional. Potential tripping hazard exists.



2.3 Item 1(Picture)



2.3 Item 2(Picture)



2.3 Item 3(Picture)



2.3 Item 4(Picture)



2.3 Item 5(Picture)



(2) Settled and separated patio wall at the rear of the house. Recommend to reset settled block as needed by a qualified person or professional.



2.3 Item 6(Picture)



(3) Separated and rotated pavers at the rear of the house. Recommend to reset pavers as needed by a qualified person or professional.



2.3 Item 7(Picture)



(4) Gap between pavers and foundation at the rear of the house. Recommend to fill gap as needed to prevent potential water penetration.



2.3 Item 8(Picture)



(5) Shrubbbery and vegetation is growing too close to the siding for proper ventilation. Recommend to trim shrubbbery a minimum of of 12 to 16 inches away from the siding to restore proper ventilation. This would be considered normal maintenance.



2.3 Item 9(Picture)



2.3 Item 10(Picture)



2.3 Item 11(Picture)



2.3 Item 12(Picture)



2.3 Item 13(Picture)



(6) Typical driveway settlement cracks. Recommend to repair or fill all cracks as needed by a qualified person. Also suggest to recoat driveway every 4 to 5 years. This would be considered normal maintenance.



2.3 Item 14(Picture)

3. Garage

3.4 GARAGE DOOR OPERATORS (Report whether or not doors will reverse when met with resistance)

Repair or Replace



Both garage doors needed excessive pressure for the auto reverse function to work properly. Recommend to adjust doors as needed by a qualified person for auto reverse to work correctly. Potential safety hazard exists.




3.4 Item 1(Picture)



3.4 Item 2(Picture)

3.5 GARAGE WALLS (INCLUDING FIREWALL SEPARATION)

Repair or Replace


 Rotted and deteriorated sill plate from excessive water penetration on the exterior. Recommend to properly grade the exterior and repair as needed to prevent water and insect damage.



3.5 Item 1(Picture)

3.6 GARAGE FLOOR

Inspected

 Typical hairline cracks located in the garage floor. Recommend to seal all cracks as discussed using a hydraulic cement as a way of monitoring floor for potential further movement. Repair as needed by a qualified person. This would be considered normal maintenance.




3.6 Item 1(Picture)

4. Kitchen Components and Appliances

4.0 FLOORS

Repair or Replace

 Excessive gap in the kitchen floor. Recommend to repair as needed by a qualified person.



4.0 Item 1(Picture)

4.7 OUTLETS SWITCHES AND FIXTURES

Repair or Replace

 (2) One nonfunctional recessed light fixture in the kitchen. Recommend to replace the bulb and test for function.



4.7 Item 3(Picture)

4.13 RANGES/OVENS/COOKTOPS


Inspected

 Could not test the cook top. Did not have the correct pan to test. FYI

5(B) . Mud Room

5.2.B DOORS (REPRESENTATIVE NUMBER)

Repair or Replace

 Hollowcore door in the mudroom is binding in the door frame. Recommend to adjust door as needed to restore proper door function by a qualified person.



5.2.B Item 1(Picture)

5.3.B FLOORS

Inspected

 Typical warped pergo floor from minor water penetration. FYI This is located in the mudroom.




5.3.B Item 1(Picture)

5(C) . Foyer

5.8.C SMOKE ALARMS


Inspected

 Recommend to replace all older smoke detectors as discussed. Lifespan for smoke detectors is approximately 10 years. FYI

5(E) . Family Room

5.1.E WALLS

Repair or Replace

 Water damaged wall in the family room. Suggest to repair gap and downspout on the exterior and repair wall as needed by a qualified person.



5.1.E Item 1(Picture)

5.3.E FLOORS

Inspected

 Typical warped pergo floor from minor water penetration. FYI This is located in the family room.



5.3.E Item 1(Picture)



5.3.E Item 2(Picture)

5.7.E OUTLETS SWITCHES AND FIXTURES

Repair or Replace


 Nonfunctional recessed light fixture in the family room. Recommend to replace the bulb and test for function.




5.7.E Item 1(Picture)

5.8.E SMOKE ALARMS

Inspected

 Recommend to replace all older smoke detectors as discussed. Lifespan for smoke detectors is approximately 10 years. FYI

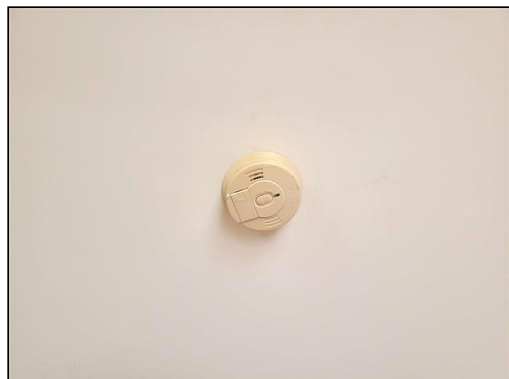

5.8.E Item 1(Picture)

5.9.E FIREPLACE/WOODBURNER

Inspected

- 🏠 Fireplace appeared to be in good condition on the day of the inspection. Recommend to have chimney cleaned and inspected by a qualified chimney sweep before using.

5(F) . Owners Suite

5.3.F FLOORS

Inspected

- 🏠 Bedroom floors were unfinished on the day of inspection. FYI

5.8.F SMOKE ALARMS

Inspected

- 🏠 Recommend to replace all older smoke detectors as discussed. Lifespan for smoke detectors is approximately 10 years. FYI

5(G) . Bedroom #2

5.2.G DOORS (REPRESENTATIVE NUMBER)

Repair or Replace


- 🏠 Bedroom #2 entrance door is missing a striker plate. Recommend to install a striker plate as needed by a qualified person.



5.2.G Item 1(Picture)


5.3.G FLOORS

Inspected

 Bedroom floors were unfinished on the day of inspection. FYI

5.8.G SMOKE ALARMS

Inspected

 Recommend to replace all older smoke detectors as discussed. Lifespan for smoke detectors is approximately 10 years. FYI

5(H) . Bedroom #3


5.3.H FLOORS

Inspected

 Bedroom floors were unfinished on the day of inspection. FYI

5.8.H SMOKE ALARMS


Inspected


 Recommend to replace all older smoke detectors as discussed. Lifespan for smoke detectors is approximately 10 years. FYI

5(I) . Bedroom #4

5.1.I WALLS

Repair or Replace

 Unfinished drywall in bedroom #4 closet. Recommend to repair or install a door as needed by a qualified person or professional.

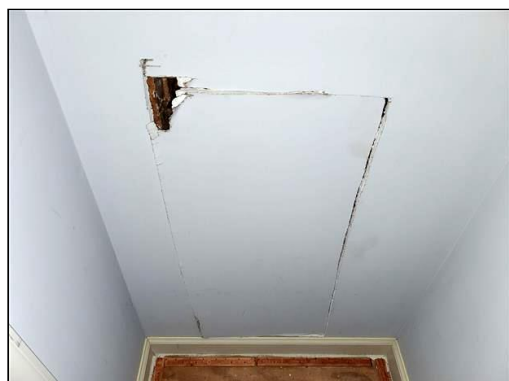

5.1.I Item 1(Picture)


5.3.I FLOORS

Inspected

 Bedroom floors were unfinished on the day of inspection. FYI

5.8.I SMOKE ALARMS

Inspected

 Recommend to replace all older smoke detectors as discussed. Lifespan for smoke detectors is approximately 10 years. FYI

6(B) . Hall Bath

6.3.B FLOORS

Inspected



Damaged vinyl floor in the hall bath. Recommend to repair or replace flooring as needed by a qualified person or professional.



6.3.B Item 1(Picture)

6(C) . Owners Suite Bath

6.1.C DOORS (REPRESENTATIVE NUMBER)

Repair or Replace



Door hardware in the owners' suite bath is not latching properly. Recommend to adjust or repair hardware as needed by a qualified person.



6.1.C Item 1(Picture)

7. Laundry Area

7.6 WASHER AND DRYER CONNECTIONS

Inspected



Suggest to replace rubber washing machine hose with stainless steel braided burst proof hose. This would be considered optional.




7.6 Item 1(Picture)

8. Electrical System


8.5 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)

Inspected

 See other comments about GFI's located in other sections of the report.


8.6 LOCATION OF MAIN AND DISTRIBUTION PANELS

Inspected

 The main panel box is located in the basement.

8.7 SMOKE DETECTORS

Inspected

 Recommend to install smoke detectors as suggested by the Fire Protection Association.

Smoke Detector Recommendations (Fire Protection Association)

The **Fire Protection Association recommends** detectors in every room in the house. The simplest rule for locating a basic smoke detector is mount it between the bedrooms and the rest of the house, but closer to the bedrooms. It is better, however, to install multiple detectors and put one near each sleeping area. In multilevel homes, install one on each level. The basement ceiling, near the steps, is a good location for extra protection. But for the best protection, locate a detector in each bedroom. Detectors have additional features to help in warning the family of fire danger and to help them escape from the house. Some are equipped with lights and are suggested for halls and stairways and any location leading to doors or windows. The idea is to light the escape route. Others have loud sirens to awaken sleeping persons or extra loud horns for use in homes where there are persons with hearing impairment.


Install each detector on the ceiling or on walls between 6" and 12" below the ceiling. Do not put it within 6" of where the wall and ceiling meet on either surface. This is dead air space with little circulation. Do not mount a detector in front of an air supply or return duct.

Test smoke detectors at least once a month.

Replace smoke detector batteries at least annually, such as when resetting clocks in the fall or spring.

8.8 CARBON MONOXIDE DETECTORS

Not Present

 There is no carbon monoxide detector found in home. It is recommended that carbon monoxide detectors be installed according to the manufacturer's instructions. Potential safety hazard exists.

9. Plumbing System

9.3 MAIN WATER SHUT-OFF DEVICE (Describe location)

Inspected

 The main shut off is the red knob located in the basement. This is for your information.



9.3 Item 1(Picture)

9.6 RADON SYSTEM

Not Present

 [RADON INFORMATION](#) Recommend to view radon report when available.

10. Heating / Central Air Conditioning

10.3 DISTRIBUTION SYSTEMS (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)

Inspected


 Air filter location. FYI



10.3 Item 1(Picture)


10.6 FIREPLACE/WOODBURNER

Not Inspected

 Fireplace appeared to be in good condition on the day of the inspection. Recommend to have chimney cleaned and inspected by a qualified chimney sweep before using.


10.8 COOLING AND AIR HANDLER EQUIPMENT

Repair or Replace

 (1) Foam freon line cover is deteriorated and damaged. Recommend to replace foam cover as needed for maximum cooling efficiency and unit longevity. Replace as needed by a qualified person.



10.8 Item 1(Picture)

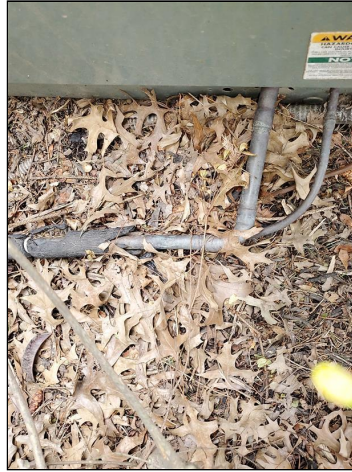

10.8 Item 2(Picture)

11. Structural Components

11.0 FOUNDATIONS, BASEMENTS AND CRAWLSPACES (Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components.)

Repair or Replace



Water penetration at the right side of the basement. Recommend to repair as needed to prevent further water penetration.

11.1 WINDOWS (REPRESENTATIVE NUMBER)

Repair or Replace



Water penetration at the window well. Recommend to install window well covers to prevent further water penetration.



11.1 Item 1(Picture)

11.2 DOORS (REPRESENTATIVE NUMBER)

Inspected



Recommend to install a door at the bottom of the steps. This will help prevent insect and rodent penetration. FYI



11.2 Item 1(Picture)

11.3 WALLS (Structural)

Repair or Replace



(1) Area of water penetration on the wall in the basement. Recommend to patch or repair honeycombed area to prevent further water penetration. Suggest to use a hydraulic cement for repair. Also recommend to make sure downspout drain at corner of house is functional.



11.3 Item 2(Picture)

11.3 Item 1(Picture)



(2) Minor water penetration in wall next to sewer and water lines. Recommend to verify downspout drains are functional.



11.3 Item 3(Picture)



(3) Typical settlement crack located in the foundation wall. Recommend to seal crack as discussed using a hydraulic cement. This will enable you to monitor same area for potential further movement.



11.3 Item 4(Picture)

11.6 STEPS, STAIRWAYS, AND RAILINGS

Repair or Replace



Missing guardrail at step area. Recommend to replace missing guardrail as needed by a qualified person. Potential safety hazard for small children exists.



11.6 Item 1(Picture)

11.8 INSULATION UNDER FLOOR SYSTEM

Repair or Replace



Loose insulation in the basement ceiling. Recommend to secure as needed by a qualified person or professional.



11.8 Item 1(Picture)



11.8 Item 2(Picture)

11.10 VENTILATION OF FOUNDATION AREA (crawlspace or basement)

Inspected



Ventilation was acceptable. Recommend to install a dehumidifier to prevent the formation of mold and mildew. Suggest to have a target setting of 45 to 50% relative humidity. This will help prevent the formation of mold and mildew.

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Robert L. Johnson

Electrical Summary



A1 House Prep LLC and Inspections

**340 Freed Road
Harleysville, Pa 19438
215-853-8226**

Customer
Matthew Missimer

Address
552 Colonial Ave
Souderton Pa 18964

The following **Electrical** items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

2. Exterior

2.7 RECEPTACLES & LIGHT FIXTURES

Repair or Replace



2 outside receptacles are non GFI receptacles. Suggest to convert to GFIs for added protection against a potentially lethal electrical shock. Replace as needed by a qualified person or electrician.



2.7 Item 1(Picture)



2.7 Item 2(Picture)

3. Garage

3.9 OUTLETS SWITCHES AND FIXTURES

Repair or Replace



Recommend to replace 3 conventional receptacles in the garage with GFI receptacles. This would be considered an added safety precaution against a potential severe electrical shock. Replace as needed by a qualified person.



3.9 Item 1(Picture)

4. Kitchen Components and Appliances

4.7 OUTLETS SWITCHES AND FIXTURES

Repair or Replace



(1) Recommend to replace conventional outlets within 6 feet of kitchen sink with GFI receptacles. This would be considered an added safety precaution against a potential severe electrical shock.



4.7 Item 1(Picture)



4.7 Item 2(Picture)

4.9 FOOD WASTE DISPOSER

Repair or Replace



The food disposer wiring is missing a romex connector (anti-strain device). I recommend repair as needed.




4.9 Item 1(Picture)

5(C) . Foyer

5.7.C OUTLETS SWITCHES AND FIXTURES

Repair or Replace

 Exterior light fixture was nonfunctional. Recommend to replace the bulb and test for function.

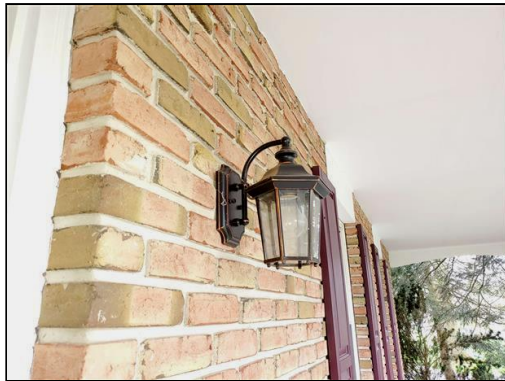


5.7.C Item 1(Picture)

6(A) . 1/2 Bath

6.5.A OUTLETS SWITCHES AND FIXTURES

Repair or Replace

 Nonfunctional GFI receptacle in the 1/2 bath. Recommend to replace nonfunctional GFI receptacle as needed by a qualified electrician. Potential safety hazard exist.




6.5.A Item 1(Picture)

6(B) . Hall Bath

6.5.B OUTLETS SWITCHES AND FIXTURES

Repair or Replace

-  No GFI receptacles are located in the hall bath room. Recommend to install GFI receptacles as needed by a qualified person. This would be considered an added safety precaution against a potential severe electrical shock.




6.5.B Item 1(Picture)

8. Electrical System

8.0 SERVICE ENTRANCE CONDUCTORS

Repair or Replace


-  Main electrical line is frayed and deteriorated and in need of replacement. Recommend to replace main power line as needed by a qualified electrician. Potential safety hazard exist.



8.0 Item 1(Picture)

8.1 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

Repair or Replace

-  Ground wire must be attached to both sides of the water meter. Attach as needed by a qualified professional.



8.1 Item 1(Picture)



8.1 Item 2(Picture)

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Robert L. Johnson

Plumbing Summary



A1 House Prep LLC and Inspections

**340 Freed Road
Harleysville, Pa 19438
215-853-8226**

Customer
Matthew Missimer

Address
552 Colonial Ave
Souderton Pa 18964

The following **Plumbing** items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

6(A) . 1/2 Bath

6.9.A PLUMBING DRAIN, WASTE AND VENT SYSTEMS

Repair or Replace



The toilet is loose at floor at the 1/2 bath. Recommend to secure toilet the the floor as needed by a qualified person or plumber.



6.9.A Item 1(Picture)

6(B) . Hall Bath

6.8.B PLUMBING WATER SUPPLY AND DISTRIBUTION SYSTEMS AND FIXTURES

Repair or Replace



Shower diverter valve in the hall bath is not functioning properly. Recommend to replace diverter valve as needed by a qualified plumber.



6.8.B Item 1(Picture)

6.9.B PLUMBING DRAIN, WASTE AND VENT SYSTEMS


Repair or Replace



Toilet in the hall bath very loose and nonfunctional. Recommend to repair as needed by a qualified plumber.



6.9.B Item 1(Picture)

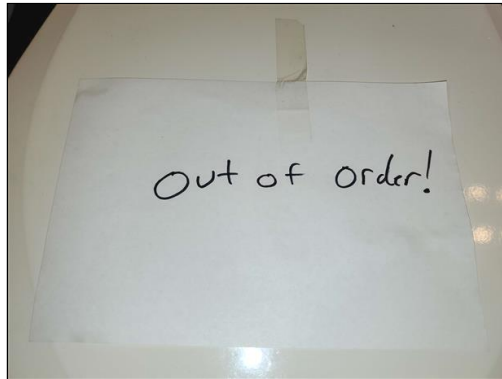

6.9.B Item 2(Picture)

9. Plumbing System

9.2 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

Repair or Replace



Hot water expansion tank is water logged. Recommend to repair or replace expansion tank as needed by a qualified person or plumber.




9.2 Item 1(Picture)

9.7 SUMP PUMP

Repair or Replace



Missing a cover on the sump pump. Recommend to install a coverplate as needed by a qualified person.

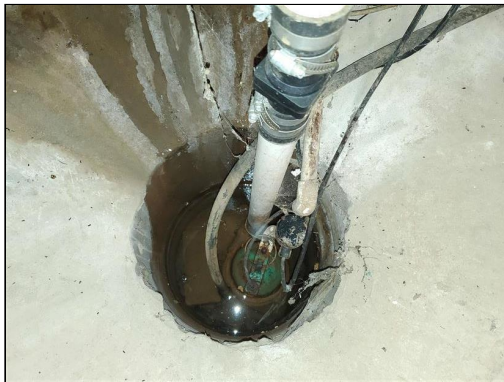

9.7 Item 1(Picture)

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Robert L. Johnson

Heating Cooling / Summary



A1 House Prep LLC and Inspections

**340 Freed Road
Harleysville, Pa 19438
215-853-8226**

Customer
Matthew Missimer

Address
552 Colonial Ave
Souderton Pa 18964

The following **Heating and Cooling** items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

10. Heating / Central Air Conditioning

10.0 HEATING EQUIPMENT

Inspected



Heating equipment was fully functional on the day of the inspection. For maximum efficiency and unit longevity suggest to have unit serviced on an annual basis. This would be considered normal maintenance.

Electric base heaters in bedroom #2, 3, 4 and hall bath are nonfunctional. FYI

10.5 CHIMNEYS, FLUES AND VENTS (for fireplaces, gas water heaters or heat systems)

Not Inspected



The liner for the fireplace was not inspected by our company. I recommend a qualified chimney sweep clean and inspect for safety.

See chimney comments.

10.8 COOLING AND AIR HANDLER EQUIPMENT

Repair or Replace



(2) Air-conditioning was not tested on the day of the inspection. Testing air conditioning in colder weather can do permanent damage to the air-conditioning system.

Suggest to have system checked before settlement if you have any concerns about system function.

The main obstacle in testing the A/C is the outdoor temperature. You should not operate an a/c unit (or heat pump in the cooling mode) when the outdoor temperature is below about 60°F or risk damaging or slugging the compressor. The problem is that the refrigerant may begin to condense (become liquid) within the compressor and damage or ruin the valves, piston, etc. Liquids are not compressible and the compressor is designed to compress gaseous refrigerant not liquid refrigerant.

10.9 NORMAL OPERATING CONTROLS

Not Inspected



Air-conditioning was not tested on the day of the inspection. Testing air conditioning in colder weather 65 degrees or less can do permanent damage to the air-conditioning system.

10.10 PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM

Not Inspected



Air-conditioning was not tested on the day of the inspection. Testing air conditioning in colder weather can do permanent damage to the air-conditioning system.

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Robert L. Johnson



A1 House Prep LLC and Inspections

Robert L. Johnson

340 Freed Road
Harleysville, Pa 19438
215-853-8226

